

## SECTION 1 IDENTIFICATION OF THE SUBSTANCES / MIXTURE AND OF THE COMPANY / UNDERTAKING

## PRODUCT IDENTIFIER

Product name	Silver Zinc
Synonyms	A101C, A101D
Proper shipping name	AEROSOLS
Other means of identification	Not Available

## RELEVANT IDENTIFIED USES OF THE SUBSTANCE OR MIXTURE AND USES ADVISED AGAINST

Relevant identified uses

Use according to manufacturer's directions. Application is by spray atomisation from a hand held aerosol pack

## DETAILS OF THE SUPPLIER OF THE SAFETY DATA SHEET

Registered company name	Silver Zinc Supplies
Address	2/10 Maiella Street Stapytlon Queensland 4207 Australia
Telephone	1300 2653 425
Fax	+61 7 3287 4568
Website	<u>silverzinc.com.au</u>
Email	orders@silverzinc.com.au

## **EMERGENCY TELEPHONE NUMBER**

Association / Organisation	Silver Zinc Supplies
Emergency Telephone Numbers	0400018006
Other emergency telephone numbers	Not Available






## **SECTION 2 HAZARDS IDENTIFICATION**

## **CLASSIFICATION OF THE SUBSTANCE OR MIXTURE**

## HAZARDOUS CHEMICAL. DANGEROUS GOODS. ACCORDING TO THE WHS REGULATIONS AND THE ADG CODE.

**CHEMWATCH HAZARD RATINGS** 

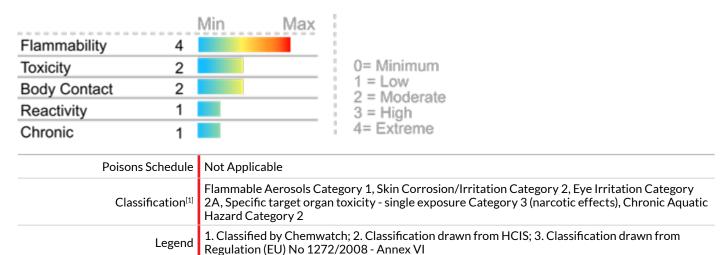

## **LABEL ELEMENTS**

Hazard Pictogram(s)







Signal Word

Danger

## HAZARD STATEMENT(S)

H222	Extremely flammable aerosol.	
H315	Causes skin irritation.	
H319	Causes serious eye irritation.	
H336	May cause drowsiness or dizziness.	
H411	Toxic to aquatic life with long lasting effects.	
AUH044	Risk of explosion if heated under confinement.	





## PRECAUTIONARY STATEMENT(S) PREVENTION

P210	Keep away from heat/sparks/open flames/hot surfaces No smoking.
P211	Do not spray on an open flame or other ignition source.
P251	Pressurized container: Do not pierce or burn, even after use.
P271	Use only outdoors or in a well-ventilated area.
P280	Wear protective gloves/protective clothing/eye protection/face protection.
P261	Avoid breathing mist/vapours/spray.
P273	Avoid release to the environment.

## PRECAUTIONARY STATEMENT(S) RESPONSE

P305 + P351 + P338	IF IN EYES: Rinse cautiously with water for several minutes. Remove contact lenses, if present and easy to do. Continue rinsing.			
P321	Specific treatment (see advice on this label).			
P362	Take off contaminated clothing and wash before reuse.			
P302 + P352	IF ON SKIN: Wash with plenty of water and soap.			
P337 + P313	Ilf eye irritation persists: Get medical advice/attention.			
P391	Collect spillage.			
P312	Call a POISON CENTER or doctor/physician if you feel unwell.			
P304 + P340	IF INHALED: Remove victim to fresh air and keep at rest in a position comfortable for breathi			
P332+P313	skin irritation occurs: Get medical advice/attention.			
P304 + P340	IF INHALED: Remove victim to fresh air and keep at rest in a position comfortable for brea			

## PRECAUTIONARY STATEMENT(S) STORAGE

P405	Store locked up.
P410 + P412	Protect from sunlight. Do not expose to temperatures exceeding 50 °C/122 °F.
P403 + P233	Store in a well-ventilated place. Keep container tightly closed.

## PRECAUTIONARY STATEMENT(S) DISPOSAL

D501	Dispose of contents/container to authorised hazardous or special waste collection point in accordance with any local regulation.
F301	accordance with any local regulation.





# **SECTION 3 COMPOSITION / INFORMATION ON INGREDIENTS**

## **SUBSTANCES**

SEE SECTION BELOW FOR COMPOSITION OF MIXTURES

## **MIXTURES**

CAS No.	% [Weight]	Name
1330-20-7	10-30	xylene
Not Available	10-30	resin, proprietary
67-64-1	10-30	acetone
7440-66-6	1-10	zinc powder
7779-90-0	1-3	zinc phosphate
7429-90-5	1-3	aluminium
115-10-6	30-40	dimethyl ether

## **SECTION 4 FIRST AID MEASURES**

## **DESCRIPTION OF FIRST AID MEASURES**

	If aerosols come in contact with the eyes:  • Immediately hold the eyelids apart and flush the eye continuously for at least 15 minute with fresh running water.
Eye Contact	<ul> <li>Ensure complete irrigation of the eye by keeping eyelids apart and away from eye and moving the eyelids by occasionally lifting the upper and lower lids.</li> </ul>
	Transport to hospital or doctor without delay.
	<ul> <li>Removal of contact lenses after an eye injury should only be undertaken by skilled personnel.</li> </ul>
	If solids or aerosol mists are deposited upon the skin:  • Flush skin and hair with running water (and soap if available).
Skin Contact	
Skiii Contact	DO NOT use solvents.
	Seek medical attention in the event of irritation.
	If aerosols, fumes or combustion products are inhaled:  Remove to fresh air.
	Lay patient down. Keep warm and rested.
Inhalation	<ul> <li>Prostheses such as false teeth, which may block airway, should be removed, where possible, prior to initiating first aid procedures.</li> </ul>
	<ul> <li>If breathing is shallow or has stopped, ensure clear airway and apply resuscitation, preferably with a demand valve resuscitator, bag-valve mask device, or pocket mask as trained. Perform CPR if necessary.</li> </ul>
	Transport to hospital, or doctor.
	Avoid giving milk or oils.
	Avoid giving alcohol.
	Not considered a normal route of entry.
Ingestion	If swallowed do NOT induce vomiting.
	<ul> <li>If vomiting occurs, lean patient forward or place on left side (head-down position, if possible) to maintain open airway and prevent aspiration.</li> </ul>
	Observe the patient carefully.
	<ul> <li>Never give liquid to a person showing signs of being sleepy or with reduced awareness;</li> <li>i.e. becoming unconscious.</li> </ul>
	<ul> <li>Give water to rinse out mouth, then provide liquid slowly and as much as casualty can comfortably drink.</li> </ul>
	Seek medical advice.



# INDICATION OF ANY IMMEDIATE MEDICAL ATTENTION AND SPECIAL TREATMENT NEEDED

Treat symptomatically.

For acute or short term repeated exposures to xylene:

- Gastro-intestinal absorption is significant with ingestions. For ingestions exceeding 1-2 ml (xylene)/ kg, intubation and lavage with cuffed endotracheal tube is recommended. The use of charcoal and cathartics is equivocal.
- Pulmonary absorption is rapid with about 60-65% retained at rest.
- Primary threat to life from ingestion and/or inhalation, is respiratory failure.
- Patients should be quickly evaluated for signs of respiratory distress (e.g. cyanosis, tachypnoea, intercostal retraction, obtundation) and given oxygen.
   Patients with inadequate tidal volumes or poor arterial blood gases (pO2 < 50 mm Hg or pCO2 > 50 mm Hg) should be intubated.
- Arrhythmias complicate some hydrocarbon ingestion and/or inhalation and electrocardiographic evidence of myocardial injury has been reported; intravenous lines and cardiac monitors should be established in obviously symptomatic patients. The lungs excrete inhaled solvents, so that hyperventilation improves clearance.
- A chest x-ray should be taken immediately after stabilisation of breathing and circulation to document aspiration and detect the presence of pneumothorax.
- Epinephrine (adrenalin) is not recommended for treatment of bronchospasm because of potential myocardial sensitisation to catecholamines. Inhaled cardioselective bronchodilators (e.g. Alupent, Salbutamol) are the preferred agents, with aminophylline a second choice.

## **BIOLOGICAL EXPOSURE INDEX - BEI**

These represent the determinants observed in specimens collected from a healthy worker exposed at the Exposure Standard (ES or TLV):

Determinant	Index	Sampling Time	Comments
Methylhippu-ric acids in urine	1.5 gm/gm creatinine 2 mg/min	End of shift Last 4hrs of shift	





## **SECTION 5 FIREFIGHTING MEASURES**

## **EXTINGUISHING MEDIA**

**SMALL FIRE: WATER SPRAY, DRY CHEMICAL OR CO2** 

LARGE FIRE: WATER SPRAY OR FOG.

## SPECIAL HAZARDS ARISING FROM THE SUBSTRATE OR MIXTURE

Fire	Incom	patib	ilitv
1 11 0		putik	,,,,,

Avoid contamination with oxidising agents i.e. nitrates, oxidising acids, chlorine bleaches,

Fire incompatibility	pool chlorine etc. as ignition may result		
ADVICE FOR FIREFIGHTERS			
Fire Fighting	<ul> <li>Alert Fire Brigade and tell them location and nature of hazard.</li> <li>May be violently or explosively reactive.</li> <li>Wear breathing apparatus plus protective gloves.</li> <li>Prevent, by any means available, spillage from entering drains or water course.</li> <li>If safe, switch off electrical equipment until vapour fire hazard removed.</li> <li>Use water delivered as a fine spray to control fire and cool adjacent area.</li> <li>DO NOT approach containers suspected to be hot.</li> <li>Cool fire exposed containers with water spray from a protected location.</li> <li>If safe to do so, remove containers from path of fire.</li> <li>Equipment should be thoroughly decontaminated after use.</li> </ul>		
Fire Explosion/Hazard	<ul> <li>Liquid and vapour are highly flammable.</li> <li>Severe fire hazard when exposed to heat or flame.</li> <li>Vapour forms an explosive mixture with air.</li> <li>Severe explosion hazard, in the form of vapour, when exposed to flame or spark.</li> <li>Vapour may travel a considerable distance to source of ignition.</li> <li>Heating may cause expansion or decomposition with violent container rupture.</li> <li>Aerosol cans may explode on exposure to naked flames.</li> <li>Rupturing containers may rocket and scatter burning materials.</li> <li>Hazards may not be restricted to pressure effects.</li> </ul>		

- Hazards may not be restricted to pressure effects.
- May emit acrid, poisonous or corrosive fumes.
- On combustion, may emit toxic fumes of carbon monoxide (CO).

#### Combustion products include:

- carbon dioxide (CO2)
- other pyrolysis products typical of burning organic material.
- Contains low boiling substance: Closed containers may rupture due to pressure buildup under fire conditions.

HAZCHEM Not Applicable





## **SECTION 6 ACCIDENTAL RELEASE MEASURES**

PERSONAL PRECAUTIONS, PROTECTIVE EQUIPMENT AND EMERGENCY PROCEDURES - SEE SECTION 8 **ENVIRONMENTAL PRECAUTIONS - SEE SECTION 12** 

## ADVIOR FOR FIREFIGUREDO

ADVICE FOR FIREFIGHTERS	
Minor Spills	<ul> <li>Clean up all spills immediately.</li> <li>Avoid breathing vapours and contact with skin and eyes.</li> <li>Wear protective clothing, impervious gloves and safety glasses.</li> <li>Shut off all possible sources of ignition and increase ventilation.</li> <li>Wipe up.</li> <li>If safe, damaged cans should be placed in a container outdoors, away from all ignition sources, until pressure has dissipated.</li> <li>Undamaged cans should be gathered and stowed safely.</li> </ul>
Major Spills	<ul> <li>Clear area of personnel and move upwind.</li> <li>Alert Fire Brigade and tell them location and nature of hazard.</li> <li>May be violently or explosively reactive.</li> <li>Wear breathing apparatus plus protective gloves.</li> <li>Prevent, by any means available, spillage from entering drains or water courses</li> <li>No smoking, naked lights or ignition sources.</li> <li>Increase ventilation.</li> <li>Stop leak if safe to do so.</li> <li>Water spray or fog may be used to disperse / absorb vapour.</li> <li>Absorb or cover spill with sand, earth, inert materials or vermiculite.</li> <li>If safe, damaged cans should be placed in a container outdoors, away from ignition sources, until pressure has dissipated.</li> <li>Undamaged cans should be gathered and stowed safely.</li> <li>Collect residues and seal in labelled drums for disposal.</li> </ul>

PERSONAL PROTECTIVE EQUIPMENT ADVICE IS CONTAINED IN SECTION 8 OF THE SDS.





## **SECTION 7 HANDLING AND STORAGE**

## PRECAUTIONS FOR SAFE HANDLING

Safe handling

- DO NOT allow clothing wet with material to stay in contact with skin
- Avoid all personal contact, including inhalation.
- Wear protective clothing when risk of exposure occurs.
- Use in a well-ventilated area.
- Prevent concentration in hollows and sumps.
- DO NOT enter confined spaces until atmosphere has been checked.
- Avoid smoking, naked lights or ignition sources.
- Avoid contact with incompatible materials.
- When handling, DO NOT eat, drink or smoke.
- DO NOT incinerate or puncture aerosol cans.
- DO NOT spray directly on humans, exposed food or food utensils.
- Avoid physical damage to containers.
- Always wash hands with soap and water after handling.
- Work clothes should be laundered separately.
- Use good occupational work practice.
- Observe manufacturer's storage and handling recommendations contained within this SDS.
- Atmosphere should be regularly checked against established exposure standards to ensure safe working conditions are maintained.

#### Keep dry to avoid corrosion of cans. Corrosion may result in container perforation and internal pressure may eject contents of can

- Store in original containers in approved flammable liquid storage area.
- DO NOT store in pits, depressions, basements or areas where vapours may be trapped.
- No smoking, naked lights, heat or ignition sources.
- Keep containers securely sealed. Contents under pressure.
- Store away from incompatible materials.
- Store in a cool, dry, well ventilated area.
- Avoid storage at temperatures higher than 40 deg C.
- Store in an upright position.
- Protect containers against physical damage.
- Check regularly for spills and leaks.
- Observe manufacturer's storage and handling recommendations contained within this SDS.

## CONDITIONS FOR SAFE STORAGE, INCLUDING ANY INCOMPATIBILITIES

Suitable container

Other Information

- Aerosol dispenser.
- Check that containers are clearly labelled.

Storage Incompatibility

- Reacts with acids producing flammable / explosive hydrogen (H2) gas
- Avoid reaction with oxidising agents















LEGEND

X – MUST NOT BE STORED TOGETHER

0 – MAY BE STORED TOGETHER WITH SPECIFIC PREVENTIONS

 $+-\mathsf{MAY}\,\mathsf{BE}\,\mathsf{STORED}\,\mathsf{TOGETHER}$ 

SILVER ZINC SUPPLIES | ABN: 58 997 237 445 | (07) 3287 4567



## SECTION 8 EXPOSURE CONTROLS / PERSONAL PROTECTION

## CONTROL PARAMETERS - OCCUPATIONAL EXPOSURE LIMITS (OEL)

## **INGREDIENT DATA**

Source	Ingredient	Sampling Time	TWA	STEL	Peak	Notes
Australia Exposure Standards	xylene	Xylene (o-, m-, p- isomers)	80ppm / 350mg / m3	655mg/m3/ 150ppm	Not Available	Not Available
Australia Exposure Standards	acetone	Acetone	500ppm / 1185mg / m3	2375mg/m3/ 1000ppm	Not Available	Not Available
Australia Exposure Standards	aluminium	Aluminium, pyro powders (as Al)	5mg/m3	Not Available	Not Available	Not Available
Australia Exposure Standards	aluminium	Aluminium (welding fumes) (as AI)	5mg/m3	Not Available	Not Available	Not Available
Australia Exposure Standards	aluminium	Aluminium (metal dust)	10mg/m3	Not Available	Not Available	Not Available
Australia Exposure Standards	dimethyl ether	Dimethyl ether	400ppm / 760mg / m3	950mg/m3/ 500ppm	Not Available	Not Available

## **EMERGENCY LIMITS**

Ingredient	Material Name	TEEL-1	TEEL-2	TEEL-3
xylene	Xylenes	Not Available	Not Available	Not Available
acetone	Acetone	Not Available	Not Available	Not Available
zinc powder	Zinc	6mg/m3	21mg/m3	120mg/m3
zinc phosphate	Zinc phosphate (3:2)	12mg/m3	36mg/m3	220mg/m3
dimethyl ether	Methyl ether; (Dimethyl ether)	3000ppm	3800*ppm	7200*ppm

Ingredient	Original IDLH	Revised IDLH
xylene	900ppm	Not Available
acetone	2500ppm	Not Available
zinc powder	Not Available	Not Available
zinc phosphate	Not Available	Not Available
aluminium	Not Available	Not Available
dimethyl ether	Not Available	Not Available

## **OCCUPATIONAL EXPOSURE BANDING**

Ingredient	Occupational Exposure Band Rating	Occupational Exposure Band Limit
zinc powder	E	≤ 0.01 mg/m³
Notes:	Occupational exposure banding is a process of assigning chemicals into specific categories or bands based on a chemical's potency and the adverse health outcomes associated with exposure. The output of this process is an occupational exposure band (OEB), which corresponds to a range of exposure concentrations that are expected to protect worker health.	





## **EXPOSURE CONTROLS**

Engineering controls are used to remove a hazard or place a barrier between the worker and the hazard. Well-designed engineering controls can be highly effective in protecting workers and will typically be independent of worker interactions to provide this high level of protection.

The basic types of engineering controls are:

- Process controls which involve changing the way a job activity or process is done to reduce the
  risk.
- Enclosure and/or isolation of emission source which keeps a selected hazard "physically" away from the worker and ventilation that strategically
- "adds" and "removes" air in the work environment. Ventilation can remove or dilute an air contaminant if designed properly. The design of a ventilation system must match the particular process and chemical or contaminant in use.
- Employers may need to use multiple types of controls to prevent employee overexposure.
- General exhaust is adequate under normal conditions. If risk of overexposure exists, wear SAA
  approved respirator. Correct fit is essential to obtain adequate protection.
- Provide adequate ventilation in warehouse or closed storage areas.
- Air contaminants generated in the workplace possess varying "escape" velocities which, in turn, determine the "capture velocities" of fresh circulating air required to effectively remove the contaminant.

## Appropriate engineering controls

Type of Contaminant	Speed
aerosols, (released at low velocity into zone of active generation)	0.5-1m/s
	1-2.5m/s (200-500 f/min.)

Within each range the appropriate value depends on:

Upper end of the range	
1: Disturbing room air currents	
2: Contaminants of high toxicity	
3: High production, heavy use	
4: Small hood-local control only	

Simple theory shows that air velocity falls rapidly with distance away from the opening of a simple extraction pipe. Velocity generally decreases with the square of distance from the extraction point (in simple cases). Therefore the air speed at the extraction point should be adjusted, accordingly, after reference to distance from the contaminating source. The air velocity at the extraction fan, for example, should be a minimum of 1-2 m/s (200-400 f/min.) for extraction of solvents generated in a tank 2 meters distant from the extraction point. Other mechanical considerations, producing performance deficits within the extraction apparatus, make it essential that theoretical air velocities are multiplied by factors of 10 or more when extraction systems are installed or used.

Personal protection













	Safety glasses with side shields.	
Eye and face protection	<ul> <li>Chemical goggles.</li> <li>Contact lenses may pose a special hazard; soft contact lenses may absorb and concentrate irritants. A written policy document, describing the wearing of lenses or restrictions on use, should be created for each workplace or task. This should include a review of lens absorption and adsorption for the class of chemicals in use and an account of injury experience. Medical and first-aid personnel should be trained in their removal and suitable equipment should be readily available. In the event of chemical exposure, begin eye irrigation immediately and remove contact lens as soon as practicable. Lens should be removed at the first signs of eye redness or irritation lens should be removed in a clean environment only after workers have washed hands thoroughly. [CDC NIOSH Current Intelligence Bulletin 59], [AS/NZS 1336 or national equivalent]</li> </ul>	
Skin protection	See Hand protection below	
Hands/feet protection	No special equipment needed when handling small quantities. OTHERWISE:  • For potentially moderate exposures: • Wear general protective gloves, eg. light weight rubber gloves. • For potentially heavy exposures: • Wear chemical protective gloves, eg. PVC. and safety footwear.	
Body protection	See Other protection below	
Other protection	No special equipment needed when handling small quantities. OTHERWISE: Overalls. Skin cleansing cream. Eyewash unit. Do not spray on hot surfaces.	





## RECOMMENDED MATERIAL(S)

#### **GLOVE SELECTION INDEX**

Glove selection is based on a modified presentation of the:

"Forsberg Clothing Performance Index".

The effect(s) of the following substance(s) are taken into account in the *computergenerated* selection:

Silver Zinc

Material	CPI
BUTYL	С
BUTYL/NEOPRENE	С
CPE	С
HYPALON	С
NAT+NEOPR+NITRILE	С
NATURAL RUBBER	С
NATURAL+NEOPRENE	С
NEOPRENE	С
NEOPRENE/NATURAL	С
NITRILE	С
NITRILE+PVC	С
PE/EVAL/PE	С
PVA	С
PVC	С
PVDC/PE/PVDC	С
SARANEX-23	С
SARANEX-23 2-PLY	С
TEFLON	С
VITON	С
VITON	С

<sup>\*</sup> CPI - Chemwatch Performance Index

A: Best Selection

B: Satisfactory; may degrade after 4 hours continuous immersion

C: Poor to Dangerous Choice for other than short term immersion

NOTE: As a series of factors will influence the actual performance of the glove, a final selection must be based on detailed observation.

## RESPIRATORY PROTECTION

Type AX Filter of sufficient capacity. (AS/NZS 1716 & 1715, EN 143:2000 & 149:2001, ANSI Z88 or national equivalent)

Where the concentration of gas/particulates in the breathing zone, approaches or exceeds the "Exposure Standard" (or ES), respiratory protection is required.

Degree of protection varies with both face-piece and Class of filter; the nature of protection varies with Type of filter.

^ - Full-face

A(All classes) = Organic vapours

, 1(, 111 0101000)		. •	
Required Minimum Protection Factor	Half-Face Respirator	Full-Face Respirator	Powered Air Respirator
up to 10 x ES	AX-AUS		AX-PAPR-AUS / Class 1
up to 50 x ES	-	AX-AUS / Class 1	-
up to 100 x ES	-	AX-2	AX-PAPR-2 ^

B AUS or B1 = Acid gasses

B2 = Acid gas or hydrogen cyanide(HCN)

B3 = Acid gas or hydrogen cyanide(HCN)

E = Sulfur dioxide(SO2)

G = Agricultural chemicals

K = Ammonia(NH3)

Hg = Mercury

NO = Oxides of nitrogen

MB = Methyl bromide

AX = Low boiling point organic compounds(below 65 degC)

Aerosols, in common with most vapours/ mists, should never be used in confined spaces without adequate ventilation. Aerosols, containing agents designed to enhance or mask smell, have triggered allergic reactions in predisposed individuals.



<sup>\*</sup> Where the glove is to be used on a short term, casual or infrequent basis, factors such as "feel" or convenience (e.g. disposability), may dictate a choice of gloves which might otherwise be unsuitable following long-term or frequent use. A qualified practitioner should be consulted.



## **SECTION 9 PHYSICAL AND CHEMICAL PROPERTIES**

## INFORMATION ON BASIC PHYSICAL AND CHEMICAL PROPERTIES

	Silver flammable liquid with a solvent odour; not miscible with water.
• •	Supplied as an aerosol pack. Contents under PRESSURE. Contains highly flammable ether
	propellant.

Physical state	Liquid	Relative density (Water = 1)	Not Available
Odour	Not Available	Partition coefficient n-octanol / water	Not Available
Odour threshold	Not Available	Auto-ignition temperature (°C)	Not Available
pH (as supplied)	Not Applicable	Decomposition temperature	Not Available
Melting point/freezing point (°C)	Not Available	Viscosity (cSt)	Not Available
Initial boiling point & boiling range (°C)	Not Available	Molecular weight (g/mol)	Not Applicable
Flash point (°C)	-41 (propellant)	Taste	Not Available
Evaporation rate	Not Available	Explosive properties	Not Available
Flammability	HIGHLY FLAMMABLE.	Oxidising properties	Not Available
Upper Explosive Limit (%)	Not Available	Surface Tension (dyn/cm or mN/m)	Not Available
Lower Explosive Limit (%)	Not Available	Volatile Component (%vol)	Not Available
Vapour pressure (kPa)	Not Available	Gas group	Not Available
Solubility in water	Immiscible	pH as a solution (1%)	Not Available
Vapour density (Air = 1)	Not Available	VOC g/L	Not Available

## **SECTION 10 STABILITY AND REACTIVITY**

Reactivity	See section 7	
Chemical stability	<ul> <li>Elevated temperatures.</li> <li>Presence of open flame.</li> <li>Product is considered stable.</li> <li>Hazardous polymerisation will not occur.</li> </ul>	
Possibility of hazardous reactions	See section 7	
Conditions to avoid	See section 7	
Incompatible materials	See section 7	
Hazardous decomposition products	See section 5	





## **SECTION 11 TOXICOLOGICAL INFORMATION**

## INFORMATION ON TOXICOLOGICAL EFFECTS

	Inhalation of aerosols (mists, fumes), generated by the material during the course of
Inhaled	<ul> <li>normal handling, may be harmful.</li> <li>The material can cause respiratory irritation in some persons. The body's response to such irritation can cause further lung damage.</li> </ul>
	<ul> <li>Inhalation of vapours may cause drowsiness and dizziness. This may be accompanied by sleepiness, reduced alertness, loss of reflexes, lack of co- ordination, and vertigo.</li> </ul>
	<ul> <li>Exposure to n-butanol causes dose dependent irritation and headaches in humans, but CNS depression and prostration in mice. Though the offensive odour may forewarn, the smell sense may become fatigued.</li> </ul>
	<ul> <li>Aliphatic alcohols with more than 3-carbons cause headache, dizziness, drowsiness, muscle weakness and delirium, central depression, coma, seizures and behavioural changes. Secondary respiratory depression and failure, as well as low blood pressure and irregular heart rhythms, may follow.</li> </ul>
	<ul> <li>Material is highly volatile and may quickly form a concentrated atmosphere in confined or unventilated areas. The vapour may displace and replace air in breathing zone, acting as a simple asphyxiant. This may happen with little warning of overexposure.</li> </ul>
	<ul> <li>Inhalation of high concentrations of gas/vapour causes lung irritation with coughing and nausea, central nervous depression with headache and dizziness, slowing of reflexes, fatigue and inco-ordination.</li> </ul>
	WARNING:Intentional misuse by concentrating/inhaling contents may be lethal.
	<ul> <li>Headache, fatigue, tiredness, irritability and digestive disturbances (nausea, loss of appetite and bloating) are the most common symptoms of xylene overexposure. Injury to the heart, liver, kidneys and nervous system has also been noted amongst workers.</li> </ul>
Ingestion	<ul> <li>Accidental ingestion of the material may be harmful; animal experiments indicate that ingestion of less than 150 gram may be fatal or may produce serious damage to the health of the individual.</li> <li>Not normally a hazard due to physical form of product.</li> </ul>
	Considered an unlikely route of entry in commercial/industrial environments
	<ul> <li>Ingestion of alkyl ethers may produce stupor, blurred vision, headache, dizziness and irritation of the nose and throat. Respiratory distress and asphyxia may result.</li> </ul>
	<ul> <li>Skin contact with the material may be harmful; systemic effects may result following absorption.</li> </ul>
	This material can cause inflammation of the skin on contact in some persons.
Skin Contact	<ul> <li>The material may accentuate any pre-existing dermatitis condition</li> <li>Repeated exposure may cause skin cracking, flaking or drying following normal</li> </ul>
	handling and use.
	<ul> <li>Spray mist may produce discomfort</li> <li>Open cuts, abraded or irritated skin should not be exposed to this material</li> </ul>
Еуе	This material can cause eye irritation and damage in some persons. Eye contact with alkyl ethers (vapour or liquid) may produce irritation, redness and tears.
	Substance accumulation, in the human body, may occur and may cause some
Chronic	<ul> <li>concern following repeated or long-term occupational exposure.</li> <li>Chronic exposure to alkyl ethers may result in loss of appetite, excessive thirst, fatigue, and weight loss.</li> </ul>
	<ul> <li>Women exposed to xylene in the first 3 months of pregnancy showed a slightly increased risk of miscarriage and birth defects. Evaluation of</li> </ul>
C. ii Offic	workers chronically exposed to xylene has demonstrated lack of genetic toxicity.
	<ul> <li>Exposure to the material for prolonged periods may cause physical defects in the developing embryo (teratogenesis).</li> </ul>
	<ul> <li>Chronic solvent inhalation exposures may result in nervous system impairment and liver and blood changes. [PATTYS]</li> </ul>





S	ILVER ZINC
	AEROSOL

TOXICITY	IRRITATION
Not Available	Not Available

## XYLENE

TOXICITY	IRRITATION
Dermal (rabbit) LD50: >1700mg / kg <sup>[2]</sup>	Eye (human): 200ppm - irritant
Inhalation (rat) LC50: 4994.295mg / I / 4h <sup>[2]</sup>	Eye (rabbit): 5mg / 24h - SEVERE
Oral (mouse) LD50: 2119mg / kg <sup>[2]</sup>	Eye (rabbit): 87mg - mild
	Eye: adverse effect observed (irritating) <sup>[1]</sup>
	Skin (rabbit):500mg / 24h - moderate
	Skin: adverse effect observed (irritating) <sup>[1]</sup>

## **ACETONE**

TOXICITY	IRRITATION
Dermal (rabbit) LD50: >20mg / kg <sup>[2]</sup>	Eye (human): 50 ppm - irritant
Inhalation (rat) LC50: 100.2mg/I/8hr <sup>[2]</sup>	Eye (rabbit): 20mg / 24hr -moderate
Oral (mouse) LD50: $1800-7300$ mg / kg $^{[2]}$	Eye (rabbit): 3.95mg - SEVERE
	Eye: adverse effect observed (irritating) <sup>[1]</sup>
	Skin (rabbit): 500mg / 24h - mild
	Skin (rabbit): 395mg (open) - mild
	Skin: no adverse effect observed (not irritating) <sup>[1]</sup>

## **ZINC POWDER**

TOXICITY	IRRITATION
dermal (rat) LD50: >2000mg / kg <sup>[2]</sup>	Eye: no adverse effect observed (not irritating) <sup>[1]</sup>
Inhalation (rat) LC50: >1.79mg / I4h <sup>[2]</sup>	Skin: no adverse effect observed (not irritating) <sup>[1]</sup>
Oral (rat) LD50: >2000mg / kg <sup>[2]</sup>	

## **ZINC PHOSPHATE**

TOXICITY	IRRITATION
Oral (rat) LD50: >5000mg / kg <sup>[2]</sup>	Eye: no adverse effect observed (not irritating) <sup>[1]</sup>
Oral (rat) LD50: $15000$ mg / $kg$ <sup>[2]</sup>	Skin: no adverse effect observed (not irritating) <sup>[1]</sup>

## **ALUMINIUM**

TOXICITY	IRRITATION
Oral (rat) LD50: >2000mg / kg <sup>[1]</sup>	Eye: no adverse effect observed (not irritating)[1]
	Skin: no adverse effect observed (not irritating) <sup>[1]</sup>

## DIMETHYL ETHER

TOXICITY	IRRITATION
Inhalation (rat) LC50: 309mg/I/4h <sup>[2]</sup>	Not Available

**LEGEND** 

1. VALUE OBTAINED FROM EUROPE ECHA REGISTERED SUBSTANCES - ACUTE TOXICITY
2.\* VALUE OBTAINED FROM MANUFACTURER'S SDS. UNLESS OTHERWISE SPECIFIED DATA EXTRACTED FROM RTECS - REGISTER OF TOXIC EFFECT OF CHEMICAL SUBSTANCES



XYLENE	Reproductive effector in rats The material may produce severe irritation to the eye causing pronounced inflammation. Repeated or prolonged exposure to irritants may produce conjunctivitis. The substance is classified by IARC as Group 3: NOT classifiable as to its carcinogenicity to humans. Evidence of carcinogenicity may be inadequate or limited in animal testing.
ACETONE	For acetone: The acute toxicity of acetone is low. Acetone is not a skin irritant or sensitizer, but it removes fat from the skin, and it also irritates the eye. Animal testing shows acetone may cause macrocytic anaemia. Studies in humans have shown that exposure to acetone at a level of 2375 mg/cubic metre has not caused neurobehavioural deficits.
ZINC POWDER	Inhalation (human) TCLo: 124 mg/m3/50min. Skin (human):0.3mg/3DaysInt. mild
ALUMINIUM	No significant acute toxicological data identified in literature search.
XYLENE & ACETONE	The material may cause skin irritation after prolonged or repeated exposure and may produce on contact skin redness, swelling, the production of vesicles, scaling and thickening of the skin.

Acute Toxicity	×	Carcinogenicity	×
Skin Irritation/Corrosion	✓	Reproductivity	×
Serious Eye Damage/Irritation	✓	STOT - Single Exposure	✓
Respiratory or Skin sensitisation	×	STOT - Repeated Exposure	×
Mutagenicity	×	Aspiration Hazard	×





## SECTION 12 ECOLOGICAL INFORMATION | TOXICITY

SILVER ZINC	Endpoint	Test Duration (hr)	Species	Value	Source
AEROSOL	Not Available	Not Available	Not Available	Not Available	Not Available
ALHOOL				V.1	
	Endpoint	Test Duration (hr)	Species	Value	Source
VVI ENE	LC50	96	Fish	2.6mg/L	2
XYLENE	EC50	48	Crustacea	1.8mg/L	2
	EC50	72	Algae or other aquatic plants	3.2mg/L	2
	NOEC	73	Algae or other aquatic plants	0.44mg/L	2
	Endpoint	Test Duration (hr)	Species	Value	Source
	LC50	96	Fish	5-540mg/L	2
ACETONE	EC50	48	Crustacea	>100mg/L	4
AULTONE	EC50	96	Algae or other aquatic plants	20.565mg/L	2
	NOEC	504	Crustacea	1-866mg/L	2
	NOLC	304	Crustacca	1 000mg/L	
	Endpoint	Test Duration (hr)	Species	Value	Source
	LC50	96	Fish	0.001-0.58mg/L	2
ZING DOWDED	EC50	48	Crustacea	0.001-0.014mg/L	2
ZINC POWDER	EC50	72	Algae or other aquatic plants	0.106mg/L	4
	BCF	360	Algae or other aquatic plants	9mg/L	4
	NOEC	72	Algae or other aquatic plants	0.00006537mg/L	2
	Endpoint	Test Duration (hr)	Species	Value	Source
ZINC PHOSPHATE	LC50	96	Fish	0.001-0.58mg/L	2
2	EC50	48	Crustacea	0.001-0.833mg/L	2
	NOEC	72	Algae or other aquatic plants	.00038608mg/L	2
	Endpoint	Test Duration (hr)	Species	Value	Source
	LC50	96	Fish	0.001-0.134mg/L	2
	EC50	48	Crustacea	0.7364mg/L	2
ALUMINIUM	EC50	72	Algae or other aquatic plants	0.001-0.799mg/L	2
	BCF	360	Algae or other aquatic plants	9mg/L	4
	NOEC	168	Crustacea	0.001mg/L	2
	INUEC	100	Crustacea	0.001mg/L	<u> </u>
	Endpoint	Test Duration (hr)	Species	Value	Source

DIMETHYL ETHER

Endpoint	Test Duration (hr)	Species	Value	Source
LC50	96	Fish	1-783.04mg/L	2
EC50	48	Crustacea	>4400.0mg/L	2
EC50	96	Algae or other aquatic plants	154.917mg/L	2
NOEC	48	Crustacea	>4000mg/L	1

LEGEND

EXTRACTED FROM 1. IUCLID TOXICITY DATA | 2. EUROPE ECHA REGISTERED SUBSTANCES - ECOTOXICOLOGICAL INFORMATION - AQUATIC TOXICITY| 3. EPIWIN SUITE | 3.12 (QSAR) - AQUATIC TOXICITY DATA (ESTIMATED) | 4. US EPA, ECOTOX DATABASE - AQUATIC TOXICITY DATA | 5. ECETOC AQUATIC HAZARD ASSESSMENT DATA | 6. NITE (JAPAN) - BIOCONCENTRATION DATA | 7. METI (JAPAN) - BIOCONCENTRATION DATA | 8. VENDOR DATA

TOXIC TO AQUATIC ORGANISMS, MAY CAUSE LONG-TERM ADVERSE EFFECTS IN THE AQUATIC ENVIRONMENT. DO NOT ALLOW PRODUCT TO COME IN CONTACT WITH SURFACE WATERS OR TO INTERTIDAL AREAS BELOW THE MEAN HIGH WATER MARK. DO NOT CONTAMINATE WATER WHEN CLEANING EQUIPMENT OR DISPOSING OF EQUIPMENT WASH-WATERS. WASTES RESULTING FROM USE OF THE PRODUCT MUST BE DISPOSED OF ON SITE OR AT APPROVED WASTE SITES.

SILVER INC SUPPLIES



#### PERSISTENCE AND DEGRADABILITY

Ingredient	Persistence: Water/Soil	Persistence: Air
xylene	HIGH (Half-life = 360 days)	LOW (Half-life = 1.83 days)
acetone	LOW (Half-life = 14 days)	LOW (Half-life = 116.25days)
dimethyl ether	LOW	LOW

## **BIOACCUMULATIVE POTENTIAL**

Ingredient	Bioaccumulation
xylene	MEDIUM (BCF = 740)
acetone	LOW (LogKOW = 0.69)
dimethyl ether	LOW (LogKOW = -0.1)

## MOBILITY IN SOIL

Ingredient	Bioaccumulation
acetone	HIGH (KOC = 1.981)
dimethyl ether	HIGH (KOC = 1.292)

## SECTION 13 DISPOSAL CONSIDERATIONS

## **WASTE TREATMENT METHODS**

Legislation addressing waste disposal requirements may differ by country, state and/or territory. Each user must refer to laws operating in their area. In some areas, certain wastes must be tracked.

A Hierarchy of Controls seems to be common - the user should investigate:

- Reduction
- Reuse
- Recycling
- Disposal (if all else fails)

Product / Packaging disposal

This material may be recycled if unused, or if it has not been contaminated so as to make it unsuitable for its intended use. If it has been contaminated, it may be possible to reclaim the product by filtration, distillation or some other means. Shelf life considerations should also be applied in making decisions of this type. Note that properties of a material may change in use, and recycling or reuse may not always be appropriate.


- DO NOT allow wash water from cleaning or process equipment to enter drains.
- It may be necessary to collect all wash water for treatment before disposal.
- In all cases disposal to sewer may be subject to local laws and regulations and these should be considered first.
- Where in doubt contact the responsible authority.
- Consult State Land Waste Management Authority for disposal.
- Discharge contents of damaged aerosol cans at an approved site.
- Allow small quantities to evaporate.
- DO NOT incinerate or puncture aerosol cans.
- Bury residues and emptied aerosol cans at an approved site.

SILVER INC SUPPLIES



## **SECTION 14 TRANSPORT INFORMATION**

## **LABELS REQUIRED**

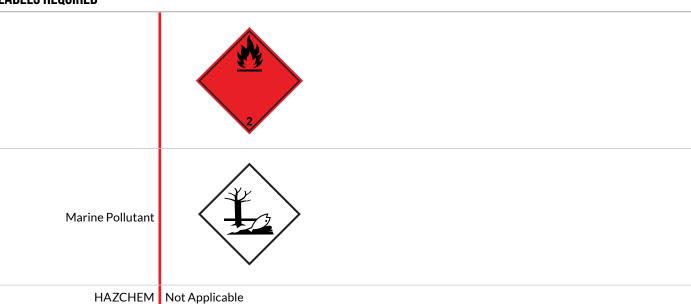

## LAND TRANSPORT (ADG)

UN number	1950		
UN proper shipping name	AEROSOLS		
Transport hazard class(es)	Class Subrisk	2.1 Not Applicable	
Packing group	Not Applicable		
Environmental hazard	Environmentally hazardous		
Special precautions for user	Special pro Limited q	ovisions 63 190 277 327 344 381 quantity 1000ml	





## AIR TRANSPORT (ICAO-IATA / DGR)

UN number	1950			
UN proper shipping name	Aerosols, flammable (er	Aerosols, flammable (engine starting fluid); Aerosols, flammable		
	ICAO/IATA Class	2.1		
Transport hazard class(es)	ICAO / IATA Subrisk	Not Applicable		
	ERG Code	10L		
Packing group	Not Applicable			
Environmental hazard	Environmentally hazardous			
	Special provisions		A145 A167 A802; A1 A145 A167 A802	
		Cargo Only Packing Instructions	203	
		Cargo Only Maximum Qty / Pack	150kg	
C	Passenger and Cargo Packing Instructions		203; Forbidden	
Special precautions for user	Passenger	and Cargo Maximum Qty / Pack	75 kg; Forbidden	
	Passenger and Cargo Limited Quantity Packing Instructions		Y203; Forbidden	
	Passenger and Cargo Limited Maximum Qty / Pack		30 kg G; Forbidden	

## SEA TRANSPORT (IMDG-CODE / GGVSEE)

UN number	1950		
UN proper shipping name	AEROSOLS		
Transport hazard class(es)	IMDG Class IMDG Subrisk		
Packing group	Not Applicable		
Environmental hazard	Marine Pollutant		
Special precautions for user	EMS Number Special provisions Limited Quantities	63 190 277 327 344 381 959	





## **SECTION 15 REGULATORY INFORMATION**

## SAFETY. HEALTH AND ENVIRONMENTAL REGULATIONS / LEGISLATION SPECIFIC FOR THE SUBSTANCE OR MIXTURE

## XYLENE IS FOUND ON THE FOLLOWING REGULATORY LISTS

Not Applicable

#### ACETONE IS FOUND ON THE FOLLOWING REGULATORY LISTS

Not Applicable

#### ZINC POWDER IS FOUND ON THE FOLLOWING REGULATORY LISTS

Not Applicable

#### ZINC PHOSPHATE IS FOUND ON THE FOLLOWING REGULATORY LISTS

Not Applicable

#### ALUMINIUM IS FOUND ON THE FOLLOWING REGULATORY LISTS

Not Applicable

#### DIMETHYL ETHER IS FOUND ON THE FOLLOWING REGULATORY LISTS

Not Applicable

National Inventory	Status
Australia - AIIC	Yes
Canada - DSL	Yes
Canada - NDSL	No (acetone; xylene; dimethyl ether; aluminium; zinc powder)
China - IECSC	Yes
Europe - EINEC / ELINCS / NLP	Yes
Japan - ENCS	No (aluminium; zinc powder)
Korea - KECI	Yes
New Zealand - NZIoC	Yes
Philippines - PICCS	Yes
USA - TSCA	Yes
Taiwan - TCSI	Yes
Mexico - INSQ	No (zinc phosphate)
Vietnam - NCI	Yes
Russia - ARIPS	Yes



#### SECTION 16 OTHER INFORMATION

Revision Date	01/11/2019
Initial Date	13/12/2013

## **SDS VERSION SUMMARY**

Version	Issue Date	Sections Updated
9.1.1.1	11/08/2016	Classification
10.1.1.1	01/11/2019	One-off system update. NOTE: This may or may not change the GHS classification

#### OTHER INFORMATION

Classification of the preparation and its individual components has drawn on official and authoritative sources as well as independent review by the Chemwatch Classification committee using available literature references.

The SDS is a Hazard Communication tool and should be used to assist in the Risk Assessment. Many factors determine whether the reported Hazards are Risks in the workplace or other settings. Risks may be determined by reference to Exposures Scenarios. Scale of use, frequency of use and current or available engineering controls must be considered.

#### **DEFINITIONS AND ABBREVIATIONS**

- PC TWA: Permissible Concentration-Time Weighted Average
- PC STEL: Permissible Concentration-Short Term Exposure Limit
- IARC: International Agency for Research on Cancer
- ACGIH: American Conference of Governmental Industrial Hygienists
- STEL: Short Term Exposure Limit
- TEEL: Temporary Emergency Exposure Limit
- IDLH: Immediately Dangerous to Life or Health Concentrations
- OSF: Odour Safety Factor
- NOAEL:No Observed Adverse Effect Level
- LOAEL: Lowest Observed Adverse Effect Level
- TLV: Threshold Limit Value
- LOD: Limit Of Detection
- OTV: Odour Threshold Value
- BCF: BioConcentration Factors
- BEI: Biological Exposure Index

## This document is copyright.

Apart from any fair dealing for the purposes of private study, research, review or criticism, as permitted under the Copyright Act, no part may be reproduced by any process without

written permission from CHEMWATCH.

TEL (+61 3) 9572 4700

